
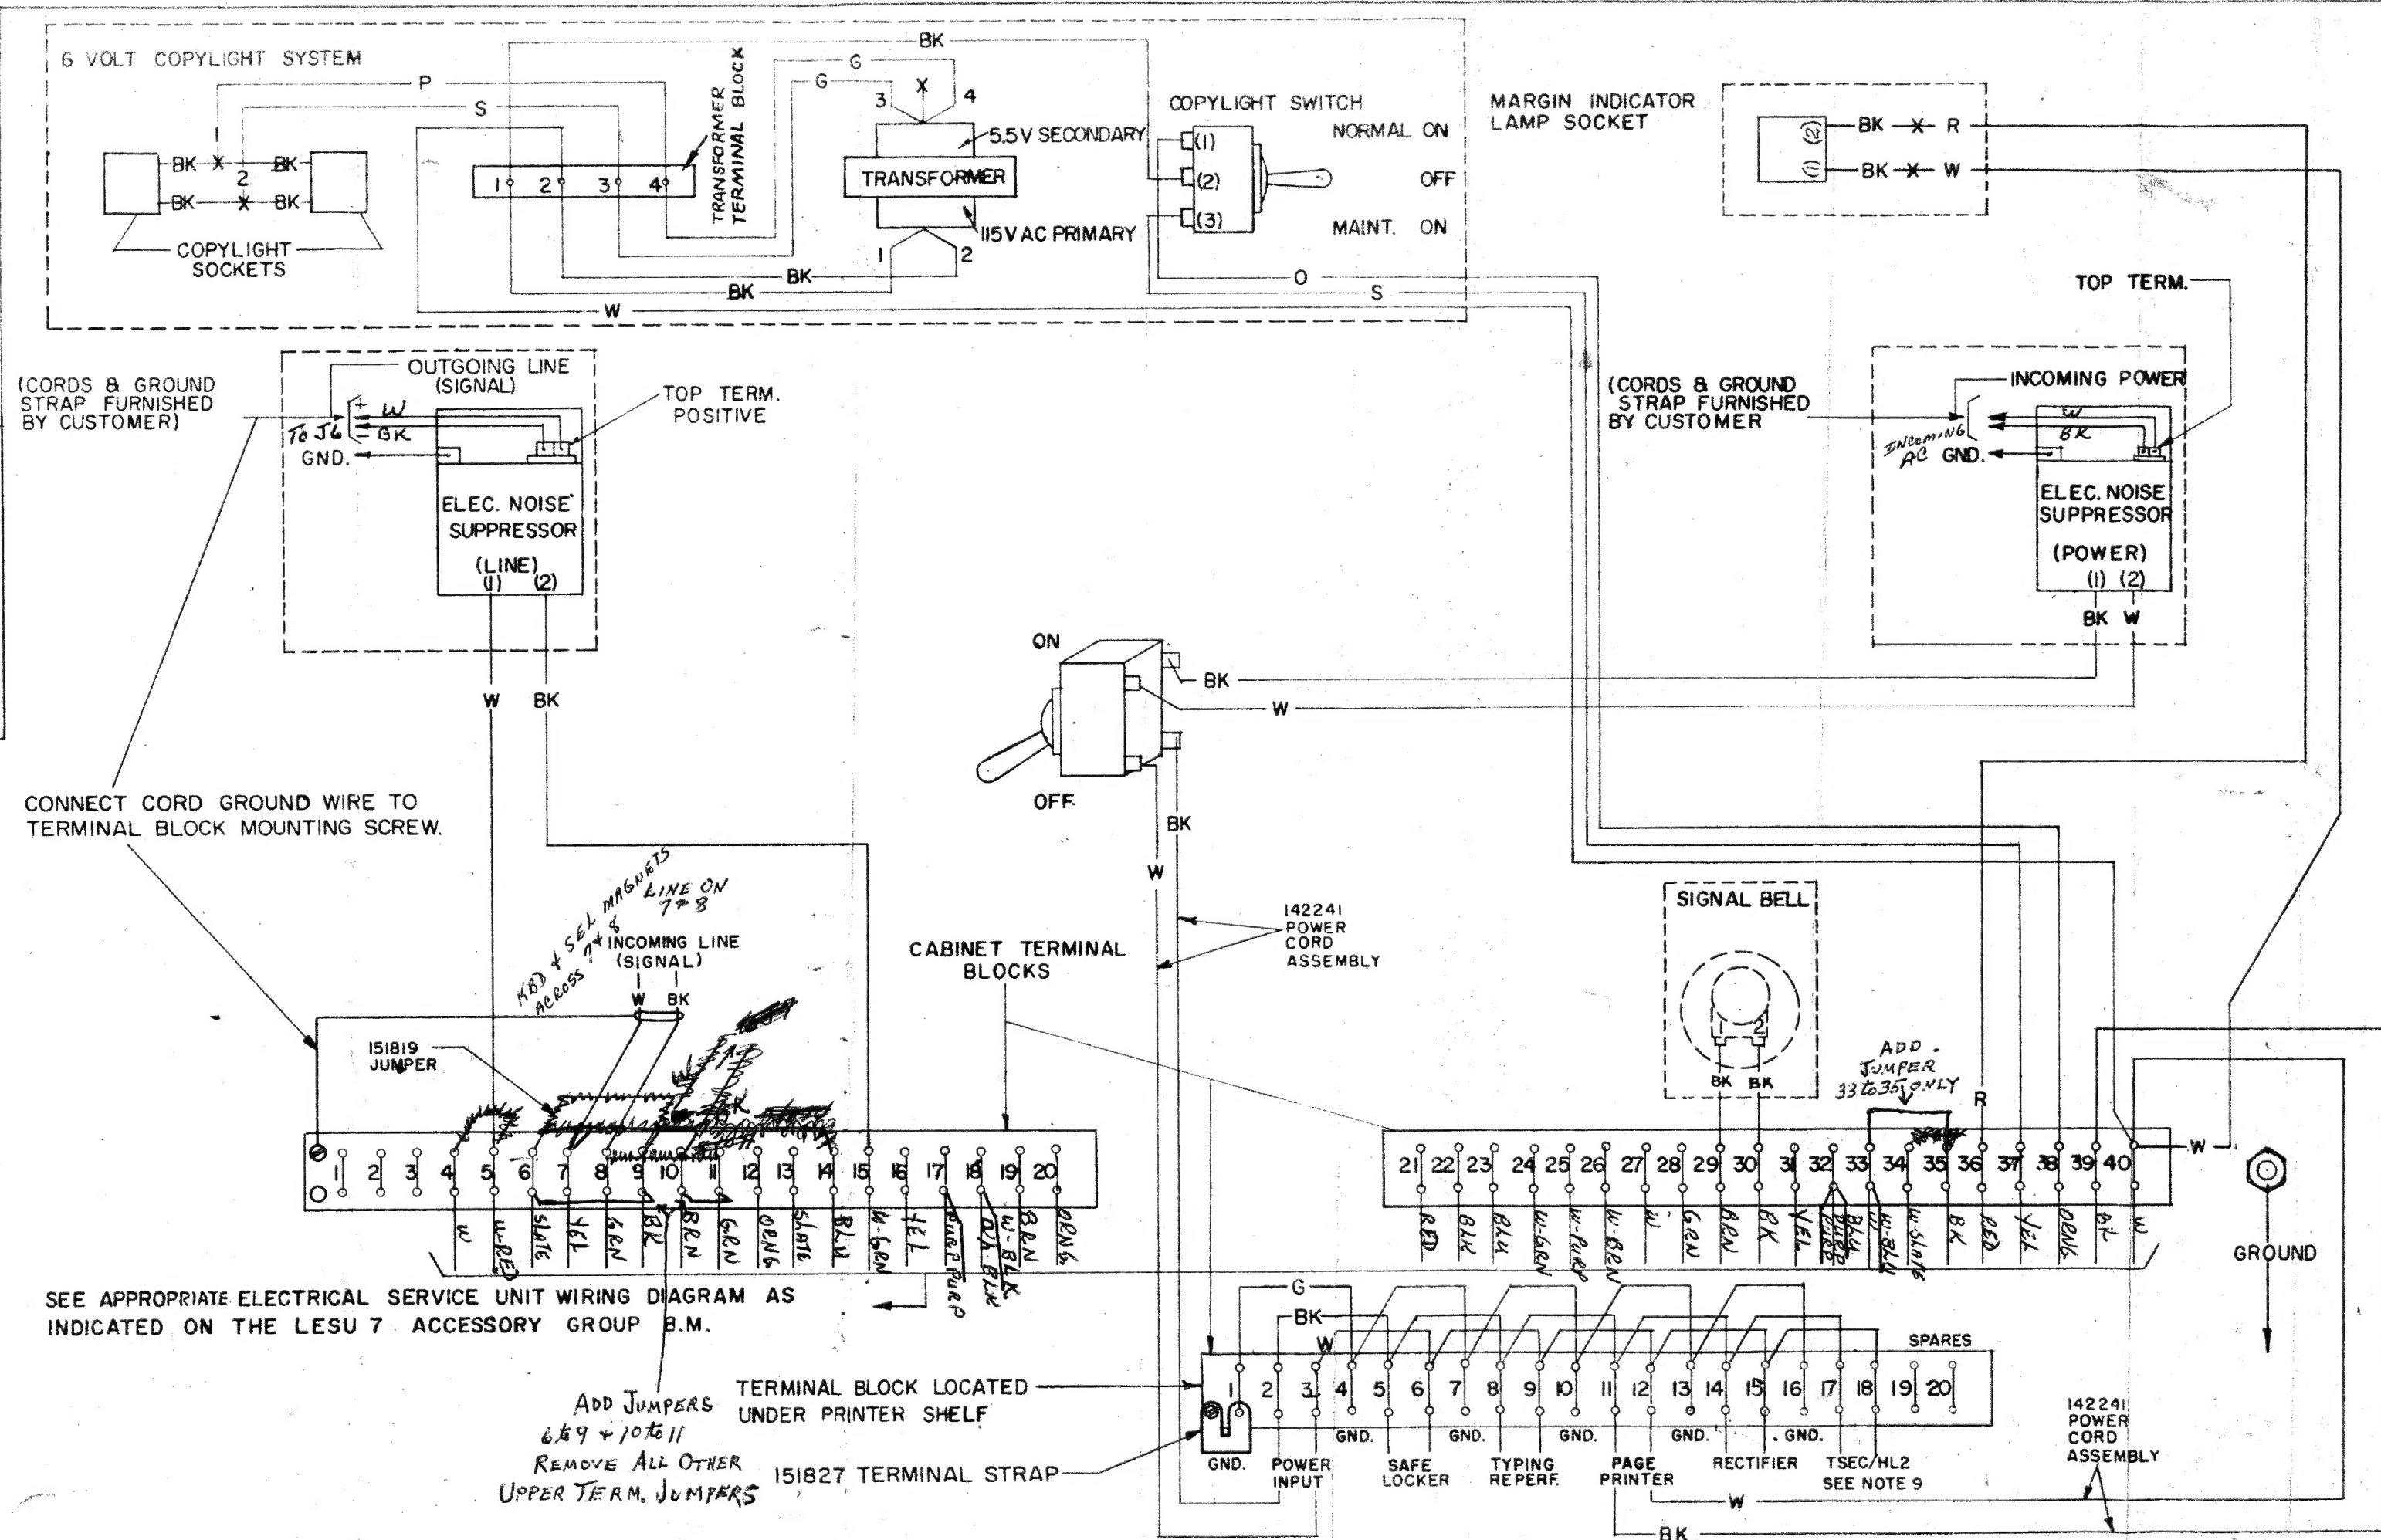


NO.	NOTES:
1	COLOR CODE: BK-BLACK W-WHITE R-RED G-GREEN P-PURPLE S-SLATE O-ORANGE
2	———X DENOTES SPLICED, SOLDERED & TAPED WIRES.
3	COMPONENTS SHOWN DOTTED ARE ACCESSORIES TO CABINET.
4	USE POWER & SIGNAL LINE INTERFERENCE SUPPRESSORS FOR INSTALLATIONS REQUIRING MINIMUM R.F. INTERFERENCE. FOR OTHER INSTALLATIONS, OMIT SUPPRESSORS & CONNECT INPUTS DIRECTLY TO TERMINALS SHOWN.
5	COMPONENTS SHOWN DOTTED ARE ACCESSORIES TO CABINET.
6	CABINET POWER CIRCUIT WIRED FOR 115 V. 50-60 $\sim$ A.C. OPERATION ONLY. THE ASSOCIATED ELECTRICAL SERVICE UNIT MUST BE WIRED FOR A.C. OPERATION.
7	NECESSARY STRAP CONNECTIONS AT THE CABINET TERMINAL BLOCKS ARE SHOWN ON THE ASSOCIATED ELECTRICAL SERVICE UNIT WIRING DIAGRAM SEE THE LESU 7 ACCESSORY GROUP B.M. FOR THE DIAGRAM NUMBER.
8	CONNECTOR VIEWED FROM SOLDER TERMINAL END.
9.	IT MAY BE NECESSARY TO INTERCHANGE THE INPUT LEADS IF AUTOMATIC TRANSMISSION OF CR LF IS INOPERATIVE.

**RTTY ELECTRONICS**  
**TELETYPE=Sales-Service-Parts**  
**PO Box 20101 El Sobrante, Ca.**  
**94820. (510)222-3102**  
**mr\_rtty@pacbell.net**

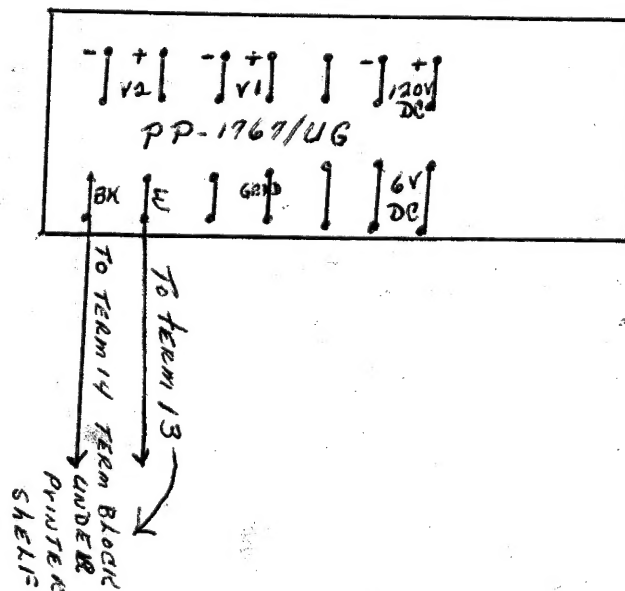

3490 WD		
ISSUE	DATE	AUTH. NO.
A	6- <del>25</del> -58	28-9399
B	8-25-58	28-9789
C	4-1-59	28-9804

77-2341

ACTUAL  
WIRING DIAGRAM  
FOR MODEL 28  
PRINTER CABINET  
LAC 207  
ACCESSORY GROUP  
248

APPROVALS	
D & R <i>[Signature]</i>	E OF M <i>[Signature]</i>
E-NO	
PROD. NO.	
DATE 4-18-58	
PD. FILE NO. 7-55.80AA	
DRAWN <i>W.A.W.</i>	CHKD. <i>RRS</i>
ENGD. <i>RRS</i>	APPD. <i>[Signature]</i>
TELETYPE CORPORATION	
3490 WD	